

Product Release Notice ErisTerminal™ 1.0.4 Firmware

Release Date: March 2015

This document contains the release notes for VTech ErisTerminal version 1.0.4. This upgrade release includes significant enhancements; therefore, users of previous ErisTerminal releases are encouraged to upgrade. The following topics are detailed below.

What's new?
Recent changes
How to upgrade
Version Compatibility
Manuals
Product support

What's new?

With the release of 1.0.4, the following features have been added. Numbers in parentheses indicate VTech's internal tracking ticket number.

Metaswitch compatibility

- Interoperability with Metaswitch has been completed with firmware version 1.0.4
- Endpoint pack is available and can be downloaded from the Metaswitch server (1090, 1177)
- New PFK function for Metaswitch: "Enhanced Call Park"
 - New VSP725 and VSP735 PFK function combines BLF (monitoring Metaswitch "Park Orbit"), performing blind transfer of a call to the park orbit, and call pickup from the park orbit. (183, 412)
- Support Intercom Call on Metaswitch
 - Added support for Metaswitch Intercom Call. Such calls are performed using Deskset PFK and will be auto-answered at the receiving extension. The PFK must have "Paging FAC" and "Page PFK value" values populated. (654)

Unlocking additional G.729 channels

 Added the capability of unlocking more than the default two G.729 channels for the VSP600 with a license key. (655)



Recent Changes

All products:

Description	Reference Number
Fixed redirected provisioning when HTTP server URL points to a provisioning file on an HTTPS server.	#1437
Corrected issue where using "reset to default" did not return tone definition, idle/bootup logo, and custom soft keys to default settings.	#1227
MWI now comes on after receiving a message waiting notification from certain servers that send additional parameters along with the subscription state.	#981
Fixed SRTP library from intermittently causing a device reset.	#1641

VSP725 and/or VSP735:

Description	Reference Number
Music on hold is now heard on VSP725/VSP735 when registered to Metaswitch.	#1259
Desksets are now generating local "page auto answer" tone for incoming page/intercom calls. Applies to Broadsoft and Metaswitch.	#1262
Fixed condition where VSP725 showed "Line(s) unregistered" with a line registered when custom logo has been enabled.	#927
Corrected intermittent problem when deleting all local directory entries (when the directory has the maximum number of entries) affecting the DECT RF link.	#1583
Corrected problem when LDAP search is executed with SSL	#1680

VSP600/VSP601:

Description	Reference Number
In the handset menu, the length of the provisioning server string (under Menu > Admin Settings > Provisioning) has been expanded from 50 to 256 characters.	#1488
Corrected low battery indication on the handset after over the air firmware update.	#1185
Performing factory reset using WebUI or reset switch now works correctly.	#1295
Fixed Broadsoft blind transfer, with proper REPLACES in the Refer-To header.	#975



How to upgrade

Please refer to the Administrator and Provisioning Manual for your ErisTerminal product, available here.

Version Compatibility

Certain features in Version 1.0.4 are not compatible with previous versions.

The Call history database has been redesigned for 1.0.4. As a consequence, the contents of those databases will no longer be available in the event of a downgrade to any previous version (#1283).

Manuals

For more information on the features described herein, please reference the Synapse manuals and technical documents located here: http://businessphones.vtech.com/support/manuals

Product support

For additional questions, please contact the VTech Business Phones team. Contact information is available here: http://businessphones.vtech.com/support/contact-us